



Rocky Flats Environmental Technology Site


TYPE 1 RECONNAISSANCE LEVEL CHARACTERIZATION REPORT (RLCR)/PRE-DEMOLITION SURVEY REPORT (PDSR)

SEWAGE TREATMENT PLANT CLOSURE PROJECT (Buildings 995-D1 and 995-D2)

REVISION 0

January 25, 2005

**CLASSIFICATION REVIEW NOT REQUIRED PER
EXEMPTION NUMBER CEX-005-02**

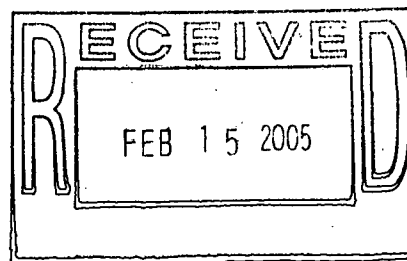

ADMIN RECORD

BZ-A-000804

1/54


**TYPE 1
RECONNAISSANCE LEVEL CHARACTERIZATION
REPORT (RLCR)/PRE-DEMOLITION SURVEY REPORT
(PDSR)**

**SEWAGE TREATMENT PLANT CLOSURE PROJECT
(Buildings 995-D1 and 995-D2)**

REVISION 0


January 25, 2005

Reviewed by:

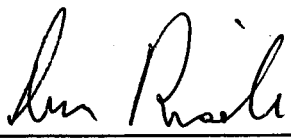
Don Risoli, Quality Assurance


Date: 1/25/05

Reviewed by:

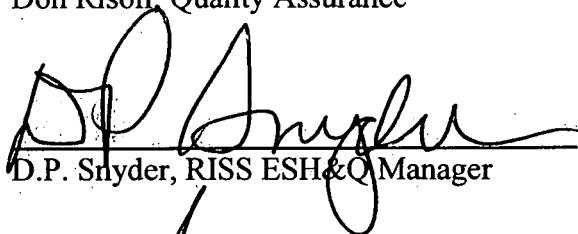
D.P. Snyder, RISS ESH&Q Manager

Date: 1/25/05

Approved by:

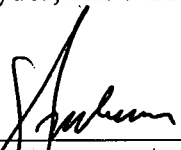
Cameron Freiboth
K-H D&D Project Manager

Date: 01/25/05

TABLE OF CONTENTS

ABBREVIATIONS/ACRONYMS	IV
EXECUTIVE SUMMARY	V
1 INTRODUCTION	1
1.1 PURPOSE	1
1.2 SCOPE.....	2
1.3 DATA QUALITY OBJECTIVES	2
2 HISTORICAL SITE ASSESSMENT	2
3 RADIOLOGICAL CHARACTERIZATION AND HAZARDS	2
4 CHEMICAL CHARACTERIZATION AND HAZARDS.....	3
4.1 ASBESTOS	3
4.2 BERYLLIUM (Be).....	4
4.3 RCRA/CERCLA CONSTITUENTS [INCLUDING METALS AND VOLATILE ORGANIC COMPOUNDS (VOCs)].....	4
4.4 POLYCHLORINATED BIPHENYLS (PCBs)	4
5 PHYSICAL HAZARDS.....	4
6 DATA QUALITY ASSESSMENT	5
7 DECOMMISSIONING WASTE TYPES AND VOLUME ESTIMATES	5
8 FACILITY CLASSIFICATION AND CONCLUSIONS.....	5
9 REFERENCES	7

ATTACHMENTS

A	Facility Location Map
B	Historical Site Assessment Report
C	Radiological Data Summaries and Survey Maps
C-1	995-D1 and 995-D2 Data Summaries and Survey Maps
C-2	RSP 07.02 Survey Forms
D	Chemical Data Summaries and Sample Maps
E	Data Quality Assessment (DQA) Detail

ABBREVIATIONS/ACRONYMS

ACM	Asbestos containing material
Be	Beryllium
CDPHE	Colorado Department of Public Health and the Environment
CERCLA	Comprehensive Emergency Response, Compensation and Liability Act
DCGL _{EMC}	Derived Concentration Guideline Level – elevated measurement comparison
DCGL _W	Derived Concentration Guideline Level – Wilcoxon Rank Sum Test
D&D	Decontamination and Decommissioning
DDCP	Decontamination and Decommissioning Characterization Protocol
DOE	U.S. Department of Energy
DPP	Decommissioning Program Plan
DQA	Data quality assessment
DQOs	Data quality objectives
EPA	U.S. Environmental Protection Agency
FDFPM	Facility Disposition Program Manual
HVAC	Heating, ventilation, air conditioning
HSAR	Historical Site Assessment Report
IHSS	Individual Hazardous Substance Site
IWCP	Integrated Work Control Package
K-H	Kaiser-Hill
LBP	Lead-based paint
LLW	Low-level waste
MARSSIM	Multi-Agency Radiation Survey and Site Investigation Manual
MDA	Minimum detectable activity
MDC	Minimum detectable concentration
NORM	Naturally occurring radioactive material
NRA	Non-Rad-Added Verification
OSHA	Occupational Safety and Health Administration
PARCC	Precision, accuracy, representativeness, comparability and completeness
PCBs	Polychlorinated Biphenyls
PDS	Pre-demolition survey
QC	Quality Control
RCRA	Resource Conservation and Recovery Act
RFCA	Rocky Flats Cleanup Agreement
RFETS	Rocky Flats Environmental Technology Site
RFEO	Rocky Flats Field Office
RLC	Reconnaissance Level Characterization
RLCR	Reconnaissance Level Characterization Report
RSP	Radiological Safety Practices
SVOCs	Semi-volatile organic compounds
TCLP	Toxicity Characteristic Leaching Procedure
TSA	Total surface activity
VOCs	Volatile organic compounds

EXECUTIVE SUMMARY

A Reconnaissance Level Characterization (RLC) and Pre-Demolition Survey (PDS) was performed to enable facility "Typing" per the DPP (10/8/98), and compliant disposition and waste management of Sewage Treatment Plant Buildings 995-D1 and 995-D2. Because these facilities were "anticipated" Type 2 facilities, the characterization was performed in accordance with the Pre-Demolition Survey Plan (MAN-127-PDSP) requirements. All facility surfaces were characterized in this RLC/PDS including the interior and exterior surfaces. Environmental media beneath and surrounding the facilities were not within the scope of this RLCR/PDSR and will be addressed at a future date using the Soil Disturbance Permit process and in compliance with RFCA. The water depletion issue will be addressed in the Adaptive Management Plan and the RI/FS.

The RLC/PDS encompassed both radiological and chemical characterization to enable compliant disposition and waste management pursuant to the D&D Characterization Protocol (MAN-077-DDCP). The characterization built upon physical, chemical and radiological hazards identified in the facility-specific Historical Site Assessment Reports.

Results indicate that no radiological contamination exists in excess of the PDSP unrestricted release limits of DOE Order 5400.5. All beryllium sample results were less than $0.1 \mu\text{g}/100\text{cm}^2$. Based on a visual inspection, no building materials suspected of containing asbestos were identified, therefore, sampling was not performed as part of this RLCR. All demolition debris will be managed in compliance with regulations governing PCBs (40 CFR 761), and Environmental Compliance Guidance #27, *Lead-Based Paint (LBP) and Lead-Based Paint Debris Disposal*, as applicable.

Based upon the data presented in this RLCR/PDSR, Sewage Treatment Plant Buildings 995-D1 and 995-D2 are considered Type 1 facilities. To ensure the facilities remain free of contamination and RLC/PDS data remain valid, Level 2 Isolation Controls have been established and the facilities posted accordingly.

1 INTRODUCTION

A Reconnaissance Level Characterization (RLC) and a Pre-Demolition Survey (PDS) was performed to enable compliant disposition and waste management of Sewage Treatment Plant Buildings 995-D1 and 995-D2. All facility surfaces were characterized in this RLC/PDS, including the interior and exterior surfaces of the facilities. Environmental media beneath and surrounding the facilities were not within the scope of this RLCR/PDSR and will be addressed at a future date using the Soil Disturbance Permit process and in compliance with RFCA. The water depletion issue will be addressed in the Adaptive Management Plan and the RI/FS.

Buildings 995-D1 and 995-D2 were "anticipated" Type 2 RFCA facilities prior to the performance of this RLC/PDS effort. A Type 2 RLC had not been performed in these buildings yet because the Sewage Treatment System has been in operation until recently, thus, the majority of building surfaces were not accessible for characterization. Since these buildings were found to be uncontaminated during the performance of this RLC/PDS effort, these buildings are reported in this RLCR/PDSR as Type 1 RFCA facilities. Since the performance of this RLC/PDS effort was performed in accordance with the Pre-Demolition Survey Plan (MAN-127-PDSP), no further characterization of these buildings is necessary.

The remaining Sewage Treatment Plant buildings not included in this RLCR/PDSR have already been characterized and documented in stand-alone RLCRs and submitted to the DOE and CDPHE for review and concurrence.

As part of the Rocky Flats Environmental Technology Site (RFETS) Closure Project, numerous facilities will be removed, among these are Sewage Treatment Plant Buildings 995-D1 and 995-D2. The location of these facilities is shown in Attachment A, *Facility Location Map*. These facilities no longer support the RFETS mission and will be removed to reduce Site infrastructure, risks and/or operating costs.

Before these facilities can be removed or demolished, an RLC and/or a PDS must be conducted; this document presents the RLC/PDS results. The RLC/PDS was conducted pursuant to the Decontamination and Decommissioning Characterization Protocol (MAN-077-DDCP) and the Pre-Demolition Survey Plan for D&D Facilities (MAN-127-PDSP). The RLC/PDS built upon physical, chemical and radiological hazards identified in the facility-specific Historical Site Assessment Reports.

1.1 Purpose

The purpose of this report is to communicate and document the results of the RLC/PDS effort. An RLC and /or PDS is performed before building demolition to define the pre-demolition radiological and chemical conditions of a facility. Pre-demolition conditions are compared with the unrestricted release limits for radiological and non-radiological contaminants. RLC/PDS results will enable project personnel to make final disposition decisions, develop related worker health and safety controls, and estimate waste volumes by waste types.

1.2 Scope

This report presents the pre-demolition radiological and chemical conditions of Sewage Treatment Plant Buildings 995-D1 and 995-D2. Environmental media beneath and surrounding the facilities was not within the scope of this RLCR/PDSR and will be addressed using the Soil Disturbance Permit process and in compliance with RFCA.

1.3 Data Quality Objectives

The Data Quality Objectives (DQOs) used in designing this RLC/PDS were the same DQOs identified in the Pre-Demolition survey Plan for D&D Facilities (MAN-127-PDSP.) Refer to section 2.0 of MAN-127-PDSP for these DQOs.

2 HISTORICAL SITE ASSESSMENT

A facility-specific Historical Site Assessment (HSA) was conducted to understand the facility histories and related hazards. The assessment consisted of facility walk-downs, interviews, and document review, including review of the Historical Release Report (refer to the D&D Characterization Protocol, MAN-077-DDCP). These assessments were used to identify data gaps and needs, and to develop radiological and chemical characterization plans. The facility-specific HSAs are documented in the *Historical Site Assessment Report (HSAR) for the Area 5 - Group 17 Facilities*, Dated April, 2003, Revision 1. Refer to Attachment B, *Historical Site Assessment Report*, for a copy of the facility-specific HSAR. In summary, the HSAR identified minimal potential for radiological and chemical hazards in Sewage Treat Plant Buildings.

3 RADIOLOGICAL CHARACTERIZATION AND HAZARDS

Sewage Treatment Plant Buildings 995-D1 and 995-D2 were characterized for radiological hazards per the PDSP. Radiological characterization was performed to define the nature and extent of radioactive materials that may be present on the facility surfaces. Measurements were performed to evaluate the contaminants of concern. Based upon a review of historical and process knowledge, building walk-downs, and MARSSIM guidance, a Radiological Characterization Plan was developed during the planning phase that describes the minimum survey requirements (refer to the RISS Characterization Project files).

Radiological survey packages 995D01 and 995D02 were developed for the interior surfaces of Sewage Treatment Plant Buildings 995-D1 and 995-D2 respectively. The survey packages were developed in accordance with Radiological Safety Practices (RSP) 16.01, *Radiological Survey/Sampling Package Design, Preparation, Control, Implementation and Closure*. All survey units were MARSSIM Class 3 areas based on process history and the low potential for residual contamination. Total surface activity (TSA), removable surface activity (RSA), and scan measurements were collected in accordance with RSP 16.02 *Radiological Surveys of Surfaces and Structures*. Radiological survey data were verified, validated and evaluated in accordance with RSP 16.04, *Radiological Survey/Sample Data Analysis*. Quality control measures were

implemented relative to the survey process in accordance with RSP 16.05, *Radiological Survey/Sample Quality Control*.

The following table details the radiological data that was obtained:

BLDG	Description	Survey Unit	TSAs	TSA QCs	RSAs	Scans %
995-D1	Digester Basin #1	995D01	20	2	20	20
995-D2	Digester Basin #2	995D02	20	2	20	20

RLC/PDS data confirmed that these facilities do not contain radiological contamination above the surface contamination guidelines provided in the PDSP. Radiological survey data, statistical analysis results, and survey locations are presented in Attachment C-1, *Radiological Data Summary and Survey Maps*. Radiological survey unit packages are maintained in the RISS Characterization Project files. Level 2 Isolation Control postings are displayed on the facilities to ensure no radioactive materials are inadvertently introduced.

The roof and ceiling surfaces of the Building 995-D1 and 995-D2 Digesters was removed and set aside for surveys during the RLC/PDS. Survey results met the RLC/PDS unrestricted release limits. Refer to Attachment C-2, *RSP 07.02 Survey Form*, for the Digester roof and ceiling survey results. Other than the roof surface, there were no other exterior surfaces associated with the Digestors.

4 CHEMICAL CHARACTERIZATION AND HAZARDS

Sewage Treatment Plant Buildings 995-D1 and 995-D2 were characterized for chemical hazards per the PDSP. Chemical characterization was performed to determine the nature and extent of chemical contamination that may be present on, or in the facilities. Based upon a review of historical and process knowledge, visual inspections, and PDSP DQOs, additional sampling needs were determined. A Chemical Characterization Plan (refer to RISS Characterization Project files) was developed during the planning phase that describes sampling requirements, the justification for the sample locations and estimated sample numbers. Contaminants of concern included asbestos, beryllium, RCRA/CERCLA constituents, lead and PCBs. Refer to Attachment D, *Chemical Data Summaries and Sample Maps*, for details on sample results and sample locations.

4.1 Asbestos

A survey of building materials suspected of containing asbestos was conducted in Sewage Treatment Plant Buildings 995-D1 and 995-D2 in accordance with the RLCP. A CDPHE-certified asbestos inspector conducted the inspection in accordance with the *Asbestos Characterization Protocol, PRO-563-ACPR, Revision 1*. No building materials suspected of containing asbestos were identified for sampling, therefore, asbestos sampling was not performed as part of this RLC/PDS.

4.2 Beryllium (Be)

Based on the HSAR and personnel interviews, Sewage Treatment Plant Buildings 995-D1 and 995-D2 were not expected to contain beryllium contamination. However, there was not adequate historical and process knowledge to conclude that beryllium was not processed or stored in these facilities. Therefore, biased beryllium sampling was performed in accordance with the PDSP and the *Beryllium Characterization Procedure, PRO-536-BCPR, Revision 0, September 9, 1999*. Biased sample locations corresponded with the most probable areas of dust accumulation (including beryllium dust), assuming airborne deposition. All beryllium smear sample results were less than $0.1 \mu\text{g}/100\text{cm}^2$ and meet the unrestricted release limits. Beryllium laboratory sample data and location maps are contained in Attachment D, *Chemical Data Summaries and Sample Maps*.

4.3 RCRA/CERCLA Constituents [including metals and volatile organic compounds (VOCs)]

Based on a review of the HSAR, and facility walk-downs, Sewage Treatment Plant Buildings 995-D1 and 995-D2 are part of the RFETS sanitary waste treatment system that was used to manage bio-solids. Material from the digesters has been sampled for total metals and determined to be below Wildlife Refuge Worker levels for all analytes. This material will be removed prior to demolition and properly characterized for disposal. The concrete digester structures will be left behind at a depth greater than 3 feet. This practice is consistent with management of the Building 990 basins. Although there was no RCRA/CERCLA sampling performed as part of this RLC/PDS, the bio-solids metal data is included in Attachment D.

Sampling for lead in paint in Sewage Treatment Plant Buildings 995-D1 and 995-D2 was not performed because there are no painted surfaces on, or in these facilities.

4.4 Polychlorinated Biphenyls (PCBs)

Based on the HSAR, interviews and a facility walk-down of Sewage Treatment Plant Buildings 995-D1 and 995-D2, PCB-containing equipment was never present in these cells and the systems were never susceptible to receiving PCBs. Therefore, PCB sampling was not performed as part of the RLC/PDS.

5 PHYSICAL HAZARDS

Physical hazards associated with Sewage Treatment Plant Buildings 995-D1 and 995-D2 consist of those common to standard industrial environments and include hazards associated with energized systems, utilities, and trips and falls. However, care should be taken during demolition activities as Sewage Treatment Plant Buildings 995-D1 and 995-D2 are located near PAC 000-500 "Sanitary Sewer System - Active". The facilities have been relatively well maintained and are in good physical condition, therefore, do not present hazards associated with building deterioration. Caution tape is erected around the tops of the digesters to prevent personnel from falling into the basins. Physical hazards are controlled by the Site Occupational Safety and Industrial Hygiene Program, which is based on OSHA regulations, DOE orders, and standard industry practices.

6 DATA QUALITY ASSESSMENT

Data used in making management decisions for decommissioning of Sewage Treatment Plant Buildings 995-D1 and 995-D2, and consequent waste management, are of adequate quality to support the decisions documented in this report. The data presented in this report (Attachments C and D) were verified and validated relative to DOE quality requirements, applicable EPA guidance, and original DQOs of the project.

In summary, the Verification and Validation (V&V) process corroborates that the following elements of the characterization process are adequate:

- ◆ the *number* of samples and surveys;
- ◆ the *types* of samples and surveys;
- ◆ the sampling/survey process as implemented "in the field"; and,
- ◆ the laboratory analytical process, relative to accuracy and precision considerations.

Details of the DQA are provided in Attachment E.

7 DECOMMISSIONING WASTE TYPES AND VOLUME ESTIMATES

The demolition and disposal of Sewage Treatment Plant Buildings 995-D1 and 995-D2 will generate sanitary waste only. Estimated waste volumes are presented below. There is no radioactive or hazardous waste.

Waste Volume Estimates and Material Types							
Facility	Concrete (cu ft)	Wood (cu ft)	Metal (cu ft)	Corrugated Sheet Metal (cu ft)	Wall Board (cu ft)	ACM (cu ft)	Other Waste (cu ft)
995-D1	1,000	0	200	0	0	0	None
995-D2	1,000	0	200	0	0	0	None

8 FACILITY CLASSIFICATION AND CONCLUSIONS

Based on the analysis of radiological, chemical and physical hazards, Sewage Treatment Plant Buildings 995-D1 and 995-D2 are classified as RFCA Type 1 facilities pursuant to the RFETS Decommissioning Program Plan (DPP; K-H, 1999) and are acceptable for demolition. The Type 1 classification is based on a review of historical and process knowledge, and newly acquired RLC/PDS data.

The RLC/PDS of Sewage Treatment Plant Buildings 995-D1 and 995-D2 was performed in accordance with the DDCP and PDSP requirements. All PDSP DQOs were met, and all data satisfied the PDSP DQA criteria. Sewage Treatment Plant Buildings 995-D1 and 995-D2 do not contain radiological or hazardous waste. All demolition debris will be managed as sanitary waste.

10

Environmental media beneath and surrounding the facilities will be addressed at a future date using the Soil Disturbance Permit process and in compliance with RFCA. The water depletion issue will be addressed in the Adaptive Management Plan and the RI/FS. To ensure Sewage Treatment Plant Buildings 995-D1 and 995-D2 remain free of contamination and RLC data remain valid, Level 2 Isolation Controls have been established with the required postings to prevent the inadvertent introduction of contaminants.

9 REFERENCES

DOE/RFFO, CDPHE, EPA, 1996. *Rocky Flats Cleanup Agreement (RFCA)*, July 19, 1996.

DOE Order 5400.5, *"Radiation Protection of the Public and the Environment."*

EPA, 1994. *"The Data Quality Objective Process,"* EPA QA/G-4.

K-H, 1999. *Decommissioning Program Plan*, June 21, 1999.

MAN-131-QAPM, *Kaiser-Hill Team Quality Assurance Program*, Rev. 1, November 1, 2001.

MAN-076-FDPM, *Facility Disposition Program Manual*, Rev. 3, January 1, 2002.

MAN-077-DDCP, *Decontamination and Decommissioning Characterization Protocol*, Rev. 3, July 15, 2002.

MAN-127-PDSP, *Pre-Demolition Survey Plan for D&D Facilities*, Rev. 1, July 15, 2002.

MARSSIM - *Multi-Agency Radiation Survey and Site Investigation Manual*, December 1997 (NUREG-1575, EPA 402-R-97-016).

PRO-475-RSP-16.01, *Radiological Survey/Sampling Package Design, Preparation, Control, Implementation, and Closure*, Rev. 1, May 22, 2001.

PRO-476-RSP-16.02, *Pre-Demolition (Final Status) Radiological Surveys of Surfaces and Structures*, Rev. 1, May 22, 2001.

PRO-477-RSP-16.03, *Radiological Samples of Building Media*, Rev. 1, May 22, 2001.

PRO-478-RSP-16.04, *Radiological Survey/Sample Data Analysis for Final Status Survey*, Rev. 1, May 22, 2001.

PRO-479-RSP-16.05, *Radiological Survey/Sample Quality Control for Final Status Survey*, Rev. 1, May 22, 2001.

PRO-563-ACPR, *Asbestos Characterization Procedure*, Revision 0, August 24, 1999.

PRO-536-BCPR, *Beryllium Characterization Procedure*, Revision 0, August 24, 1999.

RFETS, *Environmental Waste Compliance Guidance #25, Management of Polychlorinated Biphenyls (PCBs) in Paint and Other Bulk Product Waste During Facility Disposition*.

RFETS, *Environmental Waste Compliance Guidance #27, Lead-Based Paint (LBP) and Lead-Based Paint Debris Disposal*.

RFCA *Standard Operation Protocol for Recycling Concrete*, September 28, 1999.

Historical Site Assessment Report (HSAR) for the Area 5 - Group 17 Facilities, Dated April 2003, Revision 1.

ATTACHMENT A

Facility Location Map

ATTACHMENT B

Historical Site Assessment Report

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

Facility ID: (AREA 5 - GROUP 17)

Anticipated Facility Type (1, 2, or 3): Buildings 988A, 995-CCC-1, 995-CCC-2, 995-C-5, 995-EC1, 995-EC2, 995-EC3, 995-IC1, 995-IC2, and 995-IC3 are anticipated Type 1 facilities.

Buildings 974, 977, 995-AB-1, 995-AB-2, 995-C-1, 995-C-2, 995-C-3, 995-C-4, 995-D1, and 995-D2 are anticipated Type 2 facilities.

This facility-specific Historical Site Assessment (HSA) has been performed in accordance with:
D&D Characterization Protocol, RFETS MAN-077-DDCP, latest version, and
Facility Disposition Program Manual, RFETS MAN-076-FDPM, latest version

Physical Description

Building 974

Building 974 is a 2,280 square-foot non-insulated metal building, used to house 4 sludge drying beds. The drying beds were originally only covered by a roof, but were enclosed in the late 1980s. The original drying beds were constructed of sand. In the late 1980s, concrete drying beds were constructed over the original sand drying beds.

Building 974 has the following utilities: electric.

Building 977

Building 977 is a 2,880 square-foot non-insulated metal building, used to house 4 sludge drying beds. The drying beds were originally only covered by a roof, but were enclosed in the late 1980s or early 1990s. The original drying beds were constructed of sand. In the late 1980s, concrete drying beds were constructed over the original sand drying beds. Building 977 has the following utilities: electric.

Building 988A

Building 988A is the 432 square-foot building constructed in 1996. This building is constructed of insulated metal sections mounted to a steel frame and a concrete floor.

Building 988A has the following utilities: electric.

Aeration Basins 995-AB-1 and 995-AB-2

The aeration basins are each approximately 625 square-feet and constructed of concrete. The north aeration basin (995-AB-1) was constructed in 1953 and the south aeration basin (995-AB-2) was constructed in the mid 1970s. These basins are open topped basins and are equipped with air diffusers to assist in the aeration process. The compressors used to aerate the basins are located in Building 988.

The Aeration Basins have the following utilities: electric.

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

Chlorine Contact Basins 995-CCC-1 and 995-CCC-2

Chlorine Contact Basins 995-CCC-1 is approximately 65 square-feet. Chlorine Contact Basins 995-CCC-2 is approximately 200 square-feet. Both basins were built in 1953 and are constructed of concrete.

The Chlorine Contact Basins have the following utilities: electric.

Clarifier Basins 995-C-1, 995-C-2, 995-C-3, 995-C-4 and 995-C-5

Clarifier Basins 995-C-1 is approximately 200 square feet, 995-C-2 is approximately 300 square-feet, 995-C-3 is approximately 600 square-feet, 995-C-4 is approximately 650 square feet, and 995-C-5 is approximately 600 square-feet. Clarifier 995-C-1, 995-C-3, and 995-C-4, are concrete basins constructed as in 1953. Clarifier 995-C-2 and 995-C-5 are concrete basins constructed in the 1970s.

The Clarifier Basins have the following utilities: electric.

Digesters 995-D1 and 995-D2

The Digesters Basins 995-D1 and 995-D2 are approximately 500 square-foot concrete basins constructed in 1953.

The Digester Basins have the following utilities: electric.

Effluent Cells 995-EC1, 995-EC2 and 995-EC3,

The wastewater treatment plant has three 1,836 square-foot effluent cells that were constructed in 1996. These effluent treatment cells are concrete basins used to temporarily store wastewater prior to discharge to the B-Series Ponds. The effluent cells are located south east of Building 995.

The Effluent Cells have the following utilities: electric.

Influent Cells 995-IC1, 995-IC2 and 995-IC3.

The wastewater treatment plant has three 1,271 square-foot influent cells and that were constructed in 1996. These influent storage cells are concrete basins used to temporarily store wastewater entering the wastewater treatment facility and are located west of Building 995.

The Influent Cells have the following utilities: electric.

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

Historical Operations

Building 974

The west side of Building 974 houses drying beds 1, 2, 3, and 4. The east side of Building 974 is used for general storage and houses some old out-of-service sludge drying equipment. Building 974 originally had sand drying beds and was an open-sided structure. In the late 1980s walls were added to the structure and the current concrete drying beds were constructed over the existing sand beds. These upgrades were performed to prevent wind-blown dispersion of the sludge and help prevent the occasional overflow from the sludge drying beds. PAC 900-141 "Sludge Dispersal" details some of the earlier events related to the sludge drying beds. PAC 900-141 had its NFA approved in 1997. Historically the sanitary sludge was designated as low-level waste. In the summer of 2002 the low-level waste designation was removed.

Building 977

Building 977 houses drying beds 5, 6 and 7. Building 977 originally had sand drying beds and was an open-sided structure. In the late 1980s walls were added to the structure and the current concrete drying beds were constructed over the existing sand beds. These upgrades were performed to prevent wind-blown dispersion of the sludge and help prevent the occasional overflow from the sludge drying beds. PAC 900-141 "Sludge Dispersal" details some of the earlier events related to the sludge drying beds. PAC 900-141 had its NFA approved in 1997. Historically the sanitary sludge was designated as low-level waste. In the summer of 2002 the low-level waste designation was removed.

Building 988A

Building 988A is the Ultraviolet Disinfecting Facility and delivers a lethal dose of ultraviolet light to any microorganisms remaining in the treated wastewater prior to being discharged to the B-Series Ponds.

Aeration Basins 995-AB-1 and 995-AB-2

The aeration basins are used to aerate the sewage to encourage bacterial growth. Sludge from the primary clarifier enters the aeration basin where it is mixed and aerated to promote biological decomposition of organic constituents in the wastewater.

Chlorine contact chambers 995-CCC-1 and 995-CCC-2

The chlorine contact basins are used to chlorinate the wastewater during the wastewater treatment process.

Clarifier Basins 995-C-1, 995-C-2, 995-C-3 and 995-C-4

Clarifier Basin 995-C-1 and 995-C-2 is the primary clarifiers and are used to settle out solids after the wastewater is passed through the grit remover and the bar screen. The secondary clarifiers, 995-C-3 and 995-C-4, receive wastewater after it has been aerated to help settle out solid material. Flocculent (primarily lime and a cationic polymer) are added in the tertiary clarifier (995-C-5) to settle out finer solids. The sludge collected from the bottom of the primary, secondary and tertiary clarifiers are returned to the digester basins for further processing.

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

Digesters 995-D1 and 995-D2,

Sludge from the clarifier basins is sent to the digesters where the activated sludge breaks down the organic constituents. The digester basins have heat exchanges connected to heaters located in Building 995. The digester must be kept at a constant temperature in maximize the microbial action in the digester.

Effluent Cells 995-EC1, 955-EC2 and 995-EC3,

The effluent tanks are used to store wastewater so they can be evaluated to determine whether they need to be treated or discharged. The effluent and influent cells are connected by piping so their use is interchangeable.

Influent Cells 995-IC1, 995-IC2 and 995-IC3.

The primary purpose of the influent cells is to equalize flow to the wastewater treatment facility and prevent any toxic constituents from reaching the activated sludge system. The effluent and influent cells are connected by piping so their use is interchangeable.

Current Operational Status

The facilities addressed in this HSA are all currently operational.

Contaminants of Concern

Asbestos

Describe any potential, likely, or known sources of Asbestos:

Building 995 has asbestos posting. None of the facilities addressed in this HSA have had a comprehensive building inspection.

Beryllium (Be)

Describe any potential, likely, or known Be production or storage locations:

None of the facilities addressed in this HSA are on the RFETS list of Historic and Present Beryllium Areas.

Summarize any recent Be sampling results:

There is not recent Be data for the facilities addressed in this HSA.

Lead

Describe any potential, likely, or known sources of Lead (e.g., paint, shielding, etc.):

Based on the age of some of the facilities addressed in this HSA, lead in paint should not be a concern. No processes containing lead were conducted in these facilities.

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

RCRA/CERCLA Constituents

Describe any potential, likely, or known sources of RCRA/CERCLA constituents (e.g., chemical storage, waste storage, and processes):

The primary chemicals used in the wastewater treatment process were chlorine, lime and a polymer flocculent. The sanitary sewer system did not regularly receive RCRA/CERCLA Waste streams, but historically small volumes of acids, bases, solvents and photo developing chemical were discharged to the sanitary sewer system. See the IHSS, PAC, or UBC section for additional release information.

Describe any potential, likely, or known spill locations (and sources, if any):

A chromium Acid spill in 1989 killed the digestive microbes in the sanitary sewer system which caused inadequately treated waste to be discharged. This event was reported as part of the sanitary sewers system's NPDES permit.

Describe methods in which spills were mitigated, if any:

None.

PCBs

Describe any potential, likely, or known sources of PCBs (e.g., light ballasts, paints, equipment, etc.):

No PCB containing process were housed in any of the facilities addressed in this HSA. No process equipment containing PCBs were located in any of these facilities. Given the age of some of these facilities PCBs in paint may be a concern.

Describe any potential, likely, or known spill locations (and sources, if any):

No PCB spills occurred in any of the Facilities addressed in this HSA.

Describe methods in which spills were mitigated, if any:

No PCB spills occurred in any of the Facilities addressed in this HSA.

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

Radiological Contaminants

Describe any potential, likely, or known radiological production or storage locations:

In the early days of RFETS operations low levels of radioactive material in waste was discharged to the sanitary sewer system. This practice was stopped in the 1970s. The 1969 plutonium fire also caused a discharge of radiological material to the sanitary sewer system. The elevated radiological material in the system was primarily caused by firewater used to control the fire entering the system through the floor drains in the effected areas. PAC 000-500, "Sanitary Sewer System" describes some of the releases to the sanitary sewer system. See the IHSS, PAC, or UBC section for additional release information.

Describe any potential, likely, or known spill locations (e.g., known leaking sealed radioactive sources, leaking waste drums, potentially contaminated drains, etc.):

PAC 000-500, "Sanitary Sewer System" describes some of the releases to the sanitary sewer system. See the IHSS, PAC, or UBC section for additional release information.

Describe methods in which spills were mitigated, if any:

None.

Describe any potential, likely, or known isotopes of concern (e.g., weapons grade plutonium, uranium isotopes, pure beta emitters, mixed fission products, etc.):

Isotopes of concern include uranium and plutonium.

Describe any potential, likely, or known external facility contamination (e.g., stack release points, unfiltered ventilation, facility's physical location to known site releases, etc.):

See section below for information on IHSSs PACs, and UBCs.

D&D RISS Facility Characterization Historical Site Assessment Report April, 2003 Rev. 1

Environmental Restoration Concerns

Describe any ER concerns that could affect facility characterization (e.g., IHSSs, PACs, UBCs):

Buildings 974, 977, 988A, and Basins 995-AB-1 995-AB-2, 995-CCC-1, 995-CCC-2, 955-C-1, 995-C-2, 995-C-3, 995-C-4, 995-D1, 995-D2, 995-EC1, 955-EC2, 995-EC3, 995-IC1, 995-IC2, and 995-IC3 are associated or effected by the following IHSSs, PACs, or UBCs. See individual IHSS, PAC, or UBC report for additional information.

- 1) PAC 000-500, "Sanitary Sewer System" Active

Building 974 and 977 are located on the following IHSSs, PACs, and UBCs. See individual IHSS, PAC, or UBC report for additional information.

- 1) PAC 900-141 "Sludge Disposal", NFA approved 1997.

Building 977 are located near the following IHSSs, PACs, and UBCs. See individual IHSS, PAC, or UBC report for additional information.

- 1) PAC 000-190 "Caustic Leak " Active.

Additional Information

Describe any additional information that may be useful during facility characterization (e.g., contaminant migration routes, waste handling operations, physical hazards, Historical Release Reports, WSRIC data, etc.):

None

References

Provide all sources of information utilized to gather data for facility history (e.g., documents, files, interviews):

Sources reviewed to complete this HSA were the RFETS Facility List, the Historical Release Report, Site Master List of RCRA Units, and the Site IHSS, PAC, and UBC databases. The WSRIC for those buildings with a WSRIC. In addition, a facility walkdown and interviews were performed.

Waste Volume Estimates and Material Types

Facility	Concrete (cu ft)	Wood (cu ft)	Metal (cu ft)	Corrugated Sheet Metal (cu ft)	Wall Board (cu ft)	ACM (cu ft)	Other Waste (cu ft)
Building 974	1,200	0	300	500	0	TBD	N/A
Building 977	1,500	0	400	600	0	TBD	N/A
Building 988A	400	0	200	200	0	TBD	N/A
995-AB-1	600	0	100	0	0	TBD	N/A
995-AB-2	600	0	100	0	0	TBD	N/A
995-CCC-1	100	0	25	0	0	TBD	N/A
995-CCC-2	600	0	100	0	0	TBD	N/A
955-C-1	300	0	50	0	0	TBD	N/A
955-C-2	500	0	100	0	0	TBD	N/A
955-C-3	800	0	200	0	0	TBD	N/A
955-C-4	800	0	200 ¹	0	0	TBD	N/A

**D&D RISS Facility Characterization
Historical Site Assessment Report
April, 2003 Rev. 1**

995-D1	1,000	0	200	0	0	TBD	N/A
995-D2	1,000	0	200	0	0	TBD	N/A
995-EC-1	3,200	0	300	0	0	TBD	N/A
995-EC-2	3,200	0	300	0	0	TBD	N/A
995-EC-3	3,200	0	300	0	0	TBD	N/A
995-IC1	2,400	0	200	0	0	TBD	N/A
995-IC2	2,400	0	200	0	0	TBD	N/A
995-IC3	2,400	0	200	0	0	TBD	N/A

Further Actions

Recommend any further actions, if any (e.g., characterization, decontamination, special handling, etc.):

Begin the RLC/PDS process.

Note:

This HSA was performed prior to SME walkdowns, and chemical and radiological characterization package preparations. SMEs should evaluate and/or verify all information during the RLC/PDS process. SMEs may need to review additional documentation and perform additional interviews. Information contained in this HSA only represents a "snapshot" in time. Subsequent data may be obtained during SME walkdowns and chemical and radiological characterization package preparations, which may conflict with this report. However, this report will not be amended, and the newer data will take precedence over the data in this report. Newer Data will appear in the RLCR/PDSR.

Prepared By: Duane Parsons / /s/ / April 2003
Name Signature Date

ATTACHMENT C

Radiological Data Summaries and Survey Maps

ATTACHMENT C-1

Buildings 995-D1 and 995-D2

Data Summaries and Survey Maps

Survey Area: 5

Survey Unit: 995D01

Building: 995-D1

Description: 995-D1 Digester (Interior)

Rocky Flats Environmental Technology Site Final Radiological Survey Summary Results

Total Surface Activity Measurements

Nbr Random Measurements Required: 15

Nbr Biased Measurements Required: 0

Nbr QC Required: 2

Nbr Random Measurements Performed: 15

Nbr Biased Measurements Performed: 5

Nbr QC Performed: 2

Alpha

Maximum: 52.8 dpm/100cm²

Minimum: -8.1 dpm/100cm²

Mean: 24.4 dpm/100cm²

Standard Deviation: 19.3

QC Maximum: 46.2 dpm/100cm²

QC Minimum: 41.6 dpm/100cm²

QC Mean: 43.9 dpm/100cm²

Transuranic DCGL_w: 100.0 dpm/100cm²

Transuranic DCGL_{EMC}: 300.0 dpm/100cm²

Removable Surface Activity Measurements

Nbr Random Measurements Required: 15

Nbr Biased Measurements Required: 0

Nbr Random Measurements Performed: 15

Nbr Biased Measurements Performed: 5

Alpha

Maximum: 3.9 dpm/100cm²

Minimum: -0.6 dpm/100cm²

Mean: 1.3 dpm/100cm²

Standard Deviation: 1.2

Transuranic DCGL_w: 20.0 dpm/100cm²

Media Sample Results

Nbr Random Required: 0

Nbr Biased Required: 0

Nbr Random Collected: 0

Nbr Biased Collected: 0

Conclusion - A comparison of the random, biased and QC measurement results against the PDSP Table 7-1 Surface Contamination Guideline limits was conducted; the comparison demonstrates that this survey unit passes the criterion specified in the PDSP.

Survey Area: 5**Survey Unit:** 995D01**Building:** 995-D1**Description:** 995-D1 Digester (Interior)

Instrument Data Sheet

Inst/RCT Number	RCT ID	Analysis Date	Instr Model	Instru S/N	Probe Type	Calibration Due Dt	Instru Efficiency		A-Priori MDA (dpm/100cm ²)		Survey Type
							Alpha	Beta	Alpha	Beta	
1	711447	01/20/05	Electra	3552	DP-6	05/02/05	0.218	NA	48.0	NA	T/S
2	511390	01/20/05	Electra	3102	DP-6	06/16/05	0.220	NA	48.0	NA	T/Q/S
3	711447	01/20/05	SAC-4	924	NA	02/04/05	0.330	NA	10.0	NA	R
4	711447	01/20/05	SAC-4	952	NA	02/12/05	0.330	NA	10.0	NA	R

Survey Types: T = Total Surface Activity, Q = TSA QC, S = Scan, R = Removable Surface Activity, I = Investigation

Survey Area: 5**Survey Unit:** 995D01**Building:** 995-D1**Description:** 995-D1 Digester (Interior)

Random Removable Surface Activity Data Sheet

Random Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D01PRP-N001	3	0.9	N/A	
995D01PRP-N002	4	-0.3	N/A	
995D01PRP-N003	3	-0.6	N/A	
995D01PRP-N004	4	-0.3	N/A	
995D01PRP-N005	3	0.9	N/A	
995D01PRP-N006	4	2.7	N/A	
995D01PRP-N007	3	0.9	N/A	
995D01PRP-N008	4	1.2	N/A	
995D01PRP-N009	3	2.4	N/A	
995D01PRP-N010	4	2.7	N/A	
995D01PRP-N011	3	3.9	N/A	
995D01PRP-N012	4	1.2	N/A	
995D01PRP-N013	3	2.4	N/A	
995D01PRP-N014	4	1.2	N/A	
995D01PRP-N015	3	0.9	N/A	

Survey Area: 5**Survey Unit:** 995D01**Building:** 995-D1**Description:** 995-D1 Digester (Interior)

Biased Removable Surface Activity Data Sheet

Biased Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D01PBP-N016	4	1.2	N/A	
995D01PBP-N017	3	2.4	N/A	
995D01PBP-N018	4	1.2	N/A	
995D01PBP-N019	3	0.9	N/A	
995D01PBP-N020	4	-0.3	N/A	

Comments:

Survey Area: 5

Survey Unit: 995D01

Building: 995-D1

Description: 995-D1 Digester (Interior)

Random/QC Total Surface Activity Data Sheet

Random Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D01PRP-N001	2	41.1	N/A	
995D01PRP-N002	2	29.3	N/A	
995D01PRP-N003	2	3.4	N/A	
995D01PRP-N004	2	6.6	N/A	
995D01PRP-N005	1	8.3	N/A	
995D01PRP-N006	2	38.4	N/A	
995D01PRP-N007	1	51.0	N/A	
995D01QRP-N007	2	41.6	N/A	
995D01PRP-N008	2	13.9	N/A	
995D01PRP-N009	1	52.8	N/A	
995D01QRP-N009	2	46.2	N/A	
995D01PRP-N010	1	29.9	N/A	
995D01PRP-N011	1	12.9	N/A	
995D01PRP-N012	2	3.4	N/A	
995D01PRP-N013	1	28.0	N/A	
995D01PRP-N014	1	9.7	N/A	
995D01PRP-N015	1	45.0	N/A	

Comments:

995D01PBP-N020	1	47.2	N/A	
995D01PBP-N019	2	39.2	N/A	
995D01PBP-N018	1	38.0	N/A	
995D01PBP-N017	2	-1.7	N/A	
995D01PBP-N016	2	-8.1	N/A	
Biased Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	


Biased Total Surface Activity Data Sheet

Survey Area: 5	Survey Unit: 995D01	Building: 995-D1	Description: 995-D1 Digester (Interior)
----------------	---------------------	------------------	---

RLC/PDS FOR THE SEWAGE TREATMENT PLANT

Survey Area: 5 Survey Unit: 995D01 Classification: 3
 Building: 995-D1
 Survey Unit Description: 995-D1 Digester Interior
 Total Area: 150 sq. m. Floor Area: 48 sq. m.

PAGE 1 OF 1

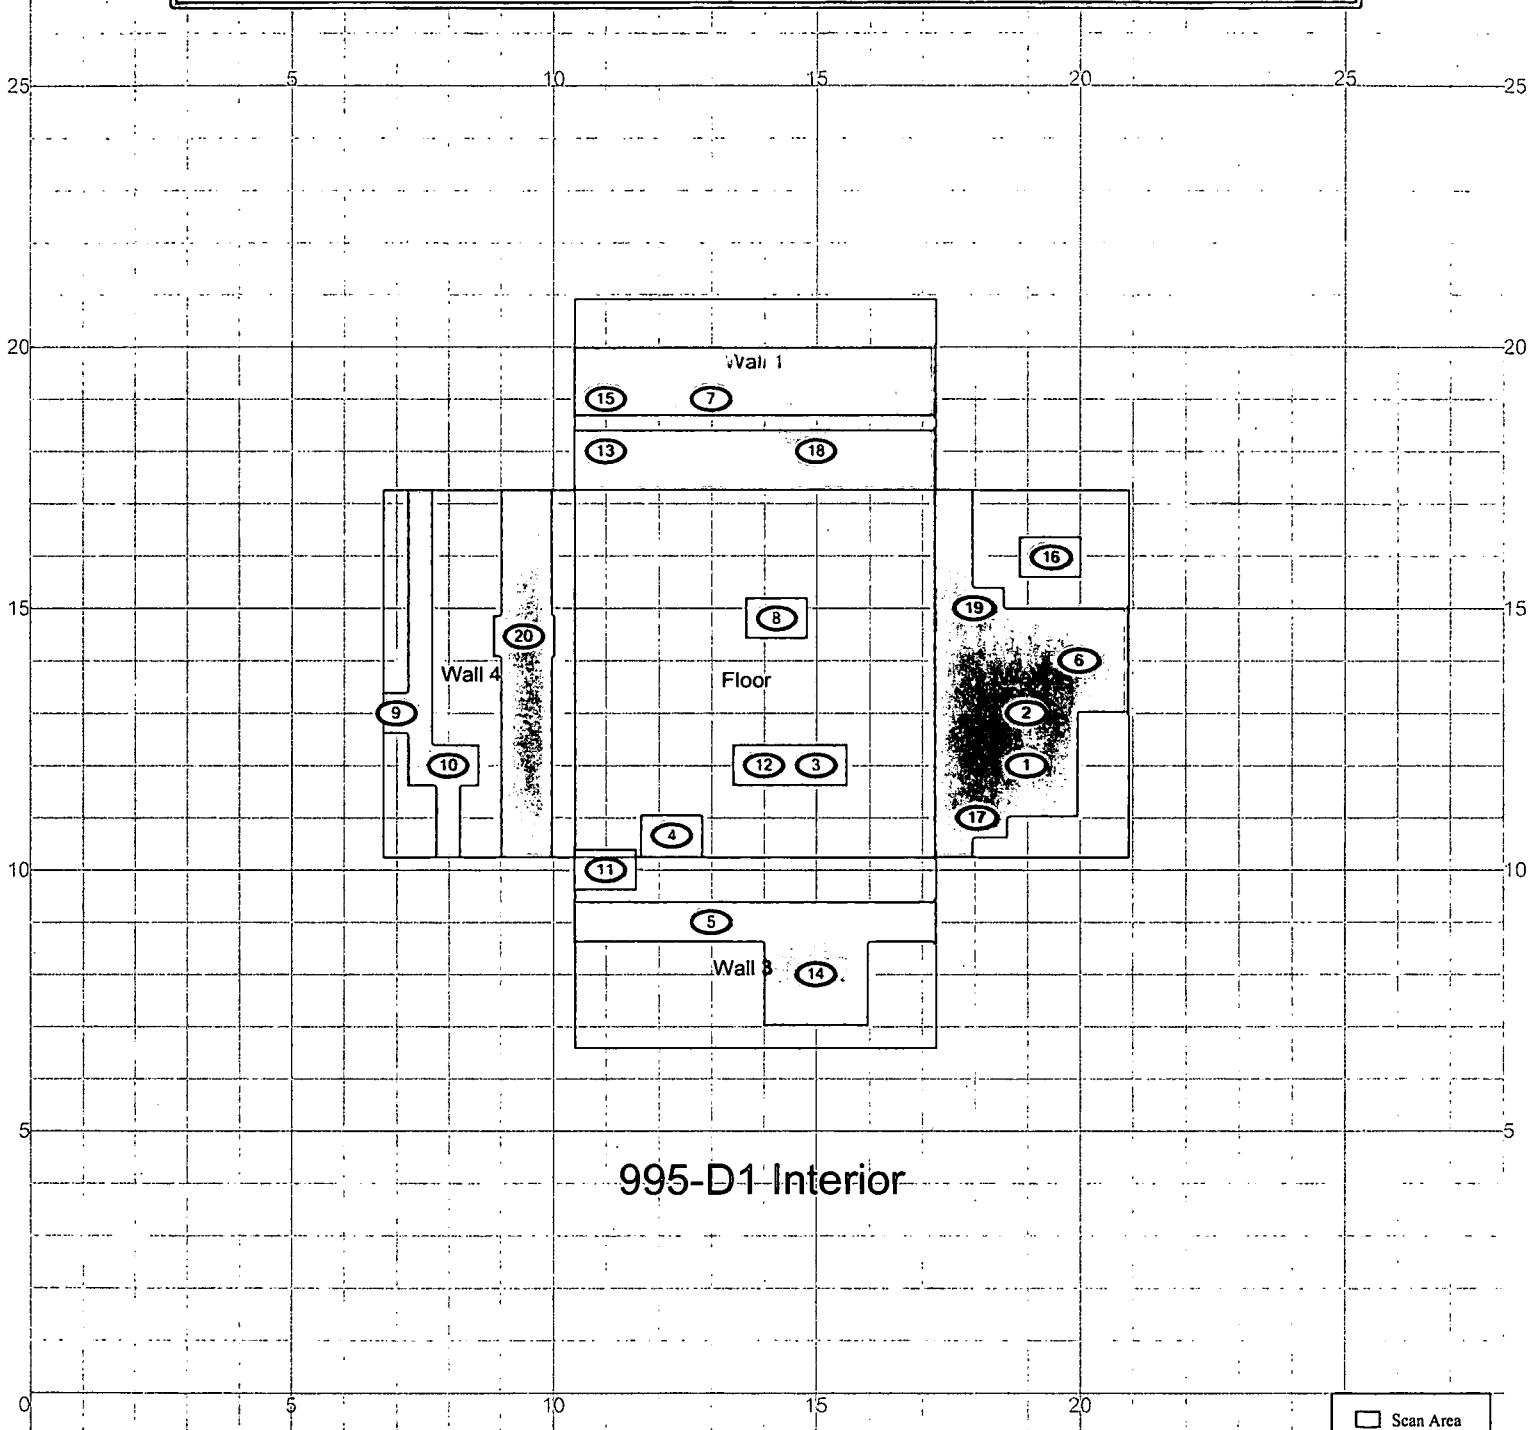

995-D1 Interior


SURVEY MAP LEGEND

- Smear & TSA Location
- Smear, TSA & Sample Location
- Open/Inaccessible Area
- Area in Another Survey Unit

Neither the United States Government, nor Kaiser Hill Co., nor CH2M Hill, nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights.

Scan Survey Information

Survey Instrument ID #(s) & RCT ID #(s):
 1, 2



1 inch = 12 feet 1 grid sq. = 1 sq. m.

U.S. Department of Energy
 Rocky Flats Environmental Technology Site

Prepared by: GIS Dept. 303-966-7707

Prepared for:



CH2MHILL
 Communications Group



MAP ID: 03-0226995-D1_SC

Jan 21, 2005

Scan Area

Survey Area: 5

Survey Unit: 995D02

Building: 995-D2

Description: 995-D2 Digester (Interior)

Rocky Flats Environmental Technology Site Final Radiological Survey Summary Results

Total Surface Activity Measurements

Nbr Random Measurements Required: 15

Nbr Biased Measurements Required: 0

Nbr QC Required: 2

Nbr Random Measurements Performed: 15

Nbr Biased Measurements Performed: 5

Nbr QC Performed: 2

Alpha

Maximum: 38.0 dpm/100cm²

Minimum: -1.1 dpm/100cm²

Mean: 13.0 dpm/100cm²

Standard Deviation: 11.6

QC Maximum: 45.7 dpm/100cm²

QC Minimum: 30.5 dpm/100cm²

QC Mean: 38.1 dpm/100cm²

Transuranic DCGL_w: 100.0 dpm/100cm²

Transuranic DCGL_{EMC}: 300.0 dpm/100cm²

Removable Surface Activity Measurements

Nbr Random Measurements Required: 15

Nbr Biased Measurements Required: 0

Nbr Random Measurements Performed: 15

Nbr Biased Measurements Performed: 5

Alpha

Maximum: 4.2 dpm/100cm²

Minimum: -0.3 dpm/100cm²

Mean: 2.0 dpm/100cm²

Standard Deviation: 1.1

Transuranic DCGL_w: 20.0 dpm/100cm²

Media Sample Results

Nbr Random Required: 0

Nbr Biased Required: 0

Nbr Random Collected: 0

Nbr Biased Collected: 0

Conclusion - A comparison of the random, biased and QC measurement results against the PDSP Table 7-1 Surface Contamination Guideline limits was conducted; the comparison demonstrates that this survey unit passes the criterion specified in the PDSP.

Survey Area: 5**Survey Unit:** 995D02**Building:** 995-D2**Description:** 995-D2 Digester (Interior)

Instrument Data Sheet

Inst/RCT Number	RCT ID	Analysis Date	Instr Model	Instru S/N	Probe Type	Calibration Due Dt	Instru Efficiency		A-Priori MDA (dpm/100cm ²)		Survey Type
							Alpha	Beta	Alpha	Beta	
1	711447	01/20/05	Electra	3552	DP-6	05/02/05	0.218	NA	48.0	NA	T/Q/S
2	511390	01/20/05	Electra	3102	DP-6	06/16/05	0.220	NA	48.0	NA	T/S
3	711447	01/20/05	SAC-4	924	NA	02/04/05	0.330	NA	10.0	NA	R
4	711447	01/20/05	SAC-4	952	NA	02/12/05	0.330	NA	10.0	NA	R

Survey Types: T = Total Surface Activity, Q = TSA QC, S = Scan, R = Removable Surface Activity, I = Investigation

Survey Area: 5**Survey Unit:** 995D02**Building:** 995-D2**Description:** 995-D2 Digester (Interior)

Random Removable Surface Activity Data Sheet

Random Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D02PRP-N001	3	0.9	N/A	
995D02PRP-N002	4	1.2	N/A	
995D02PRP-N003	3	2.4	N/A	
995D02PRP-N004	4	2.7	N/A	
995D02PRP-N005	3	2.4	N/A	
995D02PRP-N006	4	4.2	N/A	
995D02PRP-N007	3	2.4	N/A	
995D02PRP-N008	4	2.7	N/A	
995D02PRP-N009	3	0.9	N/A	
995D02PRP-N010	4	1.2	N/A	
995D02PRP-N011	3	2.4	N/A	
995D02PRP-N012	4	2.7	N/A	
995D02PRP-N013	3	2.4	N/A	
995D02PRP-N014	4	1.2	N/A	
995D02PRP-N015	3	3.9	N/A	

Survey Area: 5

Survey Unit: 995D02

Building: 995-D2

Description: 995-D2 Digester (Interior)

Biased Removable Surface Activity Data Sheet

Biased Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D02PBP-N016	4	2.7	N/A	
995D02PBP-N017	3	0.9	N/A	
995D02PBP-N018	4	1.2	N/A	
995D02PBP-N019	3	2.4	N/A	
995D02PBP-N020	4	-0.3	N/A	

Comments:

Survey Area: 5

Survey Unit: 995D02

Building: 995-D2

Description: 995-D2 Digester (Interior)

Random/QC Total Surface Activity Data Sheet

Random Measurement Location	Inst / RCT / Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D02PRP-N001	1	8.3	N/A	
995D02QRP-N002	1	30.5	N/A	
995D02PRP-N002	2	38.0	N/A	
995D02PRP-N003	1	0.5	N/A	
995D02PRP-N004	2	18.5	N/A	
995D02PRP-N005	1	15.7	N/A	
995D02PRP-N006	1	3.7	N/A	
995D02PRP-N007	2	24.4	N/A	
995D02PRP-N008	1	11.1	N/A	
995D02PRP-N009	2	4.8	N/A	
995D02PRP-N010	1	-0.9	N/A	
995D02PRP-N011	2	3.5	N/A	
995D02QRP-N012	1	45.7	N/A	
995D02PRP-N012	2	38.0	N/A	
995D02PRP-N013	2	13.9	N/A	
995D02PRP-N014	1	18.9	N/A	
995D02PRP-N015	1	9.7	N/A	

Survey Area: 5**Survey Unit:** 995D02**Building:** 995-D2**Description:** 995-D2 Digester (Interior)

Biased Total Surface Activity Data Sheet


Biased Measurement Location	Inst / RCT Nbr	Net Alpha (dpm/100cm ²)	Net Beta (dpm/100cm ²)	
995D02PBP-N016	2	0.7	N/A	
995D02PBP-N017	2	-1.1	N/A	
995D02PBP-N018	2	11.2	N/A	
995D02PBP-N019	2	18.9	N/A	
995D02PBP-N020	1	22.0	N/A	

Comments:

RLC/PDS FOR THE SEWAGE TREATMENT PLANT

Survey Area: 5 Survey Unit: 995D02 Classification: 3
 Building: 995-D2
 Survey Unit Description: 995-D2 Digester Interior
 Total Area: 150 sq. m. Floor Area: 48 sq. m.

PAGE 1 OF 1

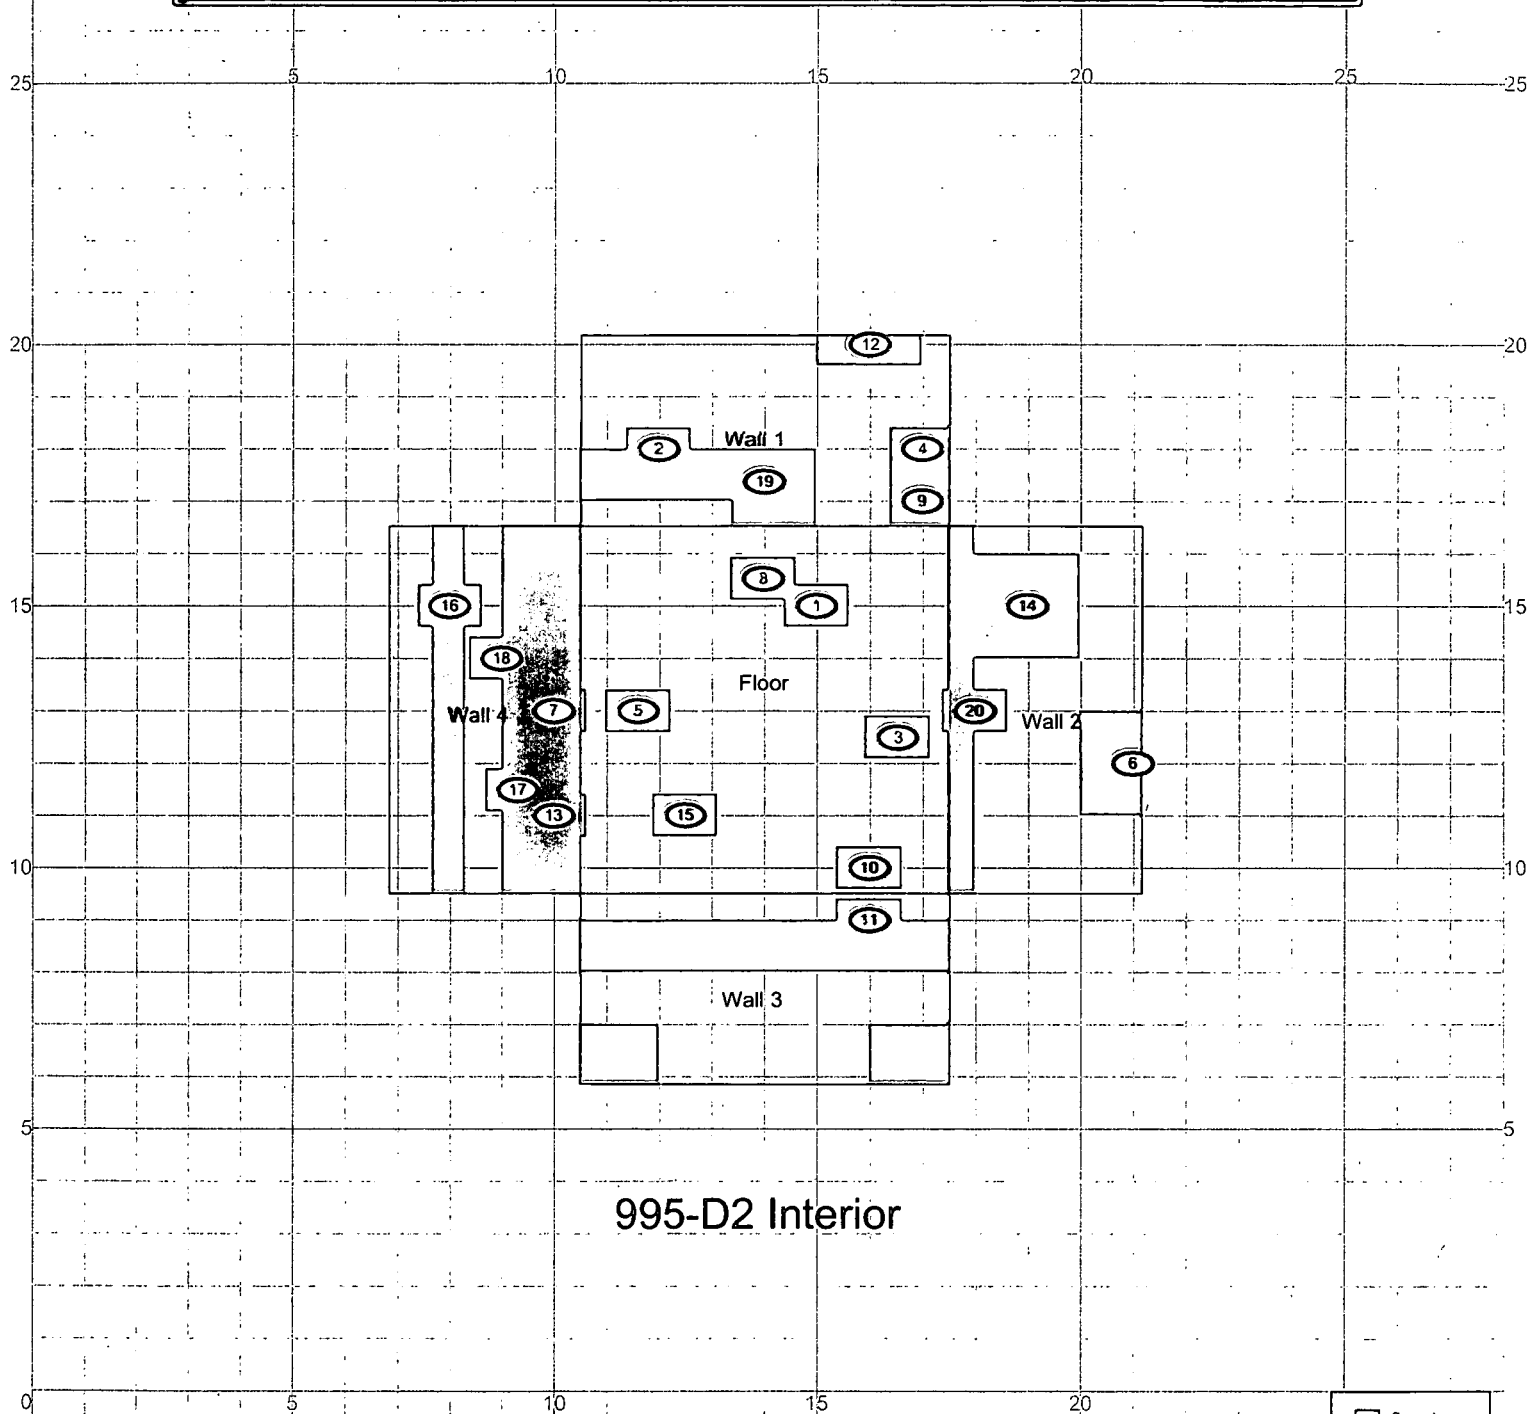

995-D2 Interior

<p>SURVEY MAP LEGEND</p> <ul style="list-style-type: none"> Smear & TSA Location Smear, TSA & Sample Location Open/Inaccessible Area Area in Another Survey Unit 	<p>Neither the United States Government, nor Kaiser Hill Co., nor CH2M Hill, nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights.</p> <p>Scan Survey Information Survey Instrument ID #(s) & RCT ID #(s): 1, 2</p>	<p>N</p> <p>0 15 FEET</p> <p>0 5 METERS</p> <p>1 inch = 12 feet 1 grid sq. = 1 sq. m.</p>	<p>U.S. Department of Energy Rocky Flats Environmental Technology Site</p> <p>Prepared by: GIS Dept. 303-966-7707 Prepared for:</p> <p>CH2MHILL Communications Group</p> <p>KAISER HILL COMPANY</p> <p>MAP ID: 03-02261995-D2_SC Jan. 21, 2005</p>
---	---	--	---

ATTACHMENT C-2

RSP 07.02 Survey Form (Roof and Ceiling Surfaces)

Survey Type: Contamination

Building:	995 <i>Piges 200 2/24/05</i>
Location:	West Decomposition tank (tank #1)
Purpose:	Verify Uncontaminated

RWP #: N/A

Date: 1/14/05 Time: 11:00

RCT: J. Kennedy /
Print name Signature

RCT: N/A / N/A / N/A
 Print name Signature Emp. #

Mfg.	Eberline	Mfg.	NE Electra	Mfg.	NA
Model	BC-4	Model	DP-6	Model	NA
Serial #	920	Serial #	1803	Serial #	NA
Cal Due	10/21/05	Cal Due	1/15/05	Cal Due	NA
Bkg	35 cpm	Bkg	490 cpm β	Bkg	NA cpm β
Eff.	14 %	Eff.	22 %	Eff.	NA %
MDA	258 dpm	MDA	480 dpm β	MDA	NA dpm β

PRN/REN # : N/A


Comments: Demolition survey of the west 995-decomposition sludge tank. Surveyed at open hatch prior to demolition then sides of tank after roof was crushed into tank. Removed 20% of rubble from bottom of tank and performed alpha and beta scan. All results < MDA

[illegible]

@RAH

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Drawing Showing Survey Points

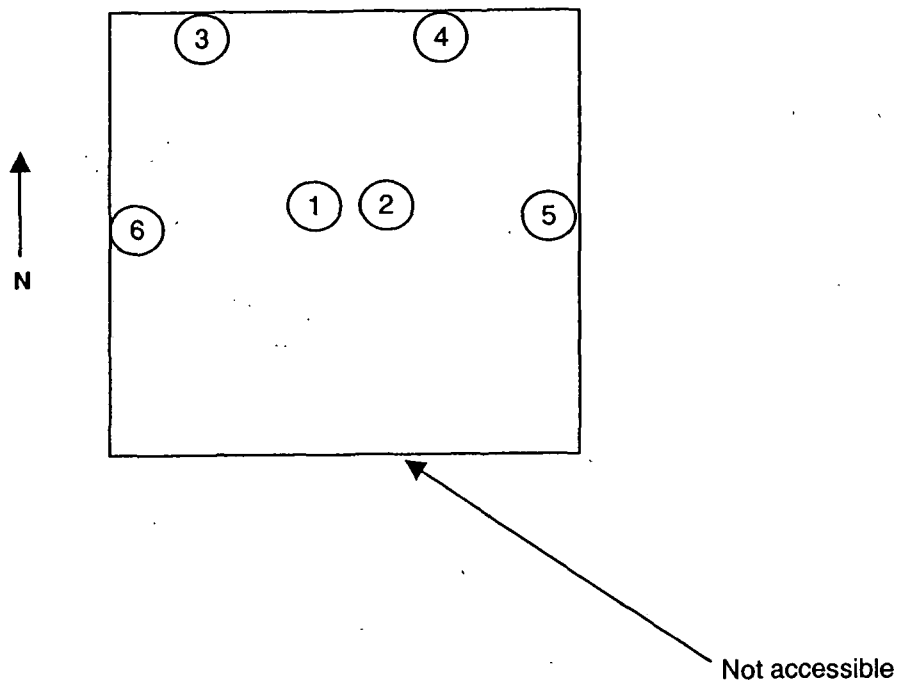

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

INSTRUMENT DATA

Mfg.	Eberline	Mfg.	NE Electra	Mfg.	NA
Model	SAC-4	Model	DP-6	Model	NA
Serial #	978	Serial #	1518	Serial #	NA
Cal Due	6/8/05	Cal Due	6/10/05	Cal Due	NA
Bkg	0.2 cpm	Bkg	2 cpm α	Bkg	NA cpm α
Eff.	33 %	Eff.	20.9 %	Eff.	NA %
MDA	20 dpm	MDA	44 dpm α	MDA	NA dpm α

Survey Type: Contamination

Building: 995 *Digester #12465*Location: East ~~Decomposition~~ tank (tank #2)

Purpose: Verify Uncontaminated

RWP #: N/A

Date: 1/13/05 Time: 18:00

RCT: *R.M. Givens* *[Signature]* *[Redacted]*
Print name Signature Emp. #

RCT: N/A / N/A / N/A
Print name Signature Emp. #

Mfg.	Eberline	Mfg.	NE Electra	Mfg.	NA
Model	BC-4	Model	DP-6	Model	NA
Serial #	920	Serial #	1518	Serial #	NA
Cal Due	10/21/05	Cal Due	6/10/05	Cal Due	NA
Bkg	34 cpm	Bkg	367 cpm β	Bkg	NA cpm β
Eff.	14 %	Eff.	22 %	Eff.	NA %
MDA	258 dpm	MDA	417 dpm β	MDA	NA dpm β

PRN/REN #: N/A

Comments: *Digester #12465*
Demolition survey of the west 995 ~~decomposition~~ sludge tank. Surveyed at open hatch prior to demolition then sides of tank after roof was crushed into tank. Removed 20% of rubble from bottom of tank and performed alpha and beta scan. All results < MDA

Swipe #	LOCATION	ALPHA			BETA		
		Swipe	Direct	Wipe	Swipe	Direct	Wipe
		dpm/100cm ²	dpm/100cm ²	dpm/wipe	dpm/100cm ²	dpm/100cm ²	dpm/wipe
1	Inside hatch cover	<20	<44	N/A	<258	<417	N/A
2	Inside hatch cover	<20	<44	N/A	<258	<417	N/A
3	six feet down the side of the tank	<20	<44	N/A	<258	<417	N/A
4	six feet down the side of the tank	<20	<44	N/A	<258	<417	N/A
5	six feet down the side of the tank	<20	<44	N/A	<258	<417	N/A
6	six feet down the side of the tank	<20	<44	N/A	<258	<417	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A

Date Reviewed: JAN 21 2005 Supervision: Steve Gernatt


Print Name

Signature

Emp. #

ROCKY FLATS ENVIRONMENTAL TECHNOLOGY SITE

Drawing Showing Survey Points

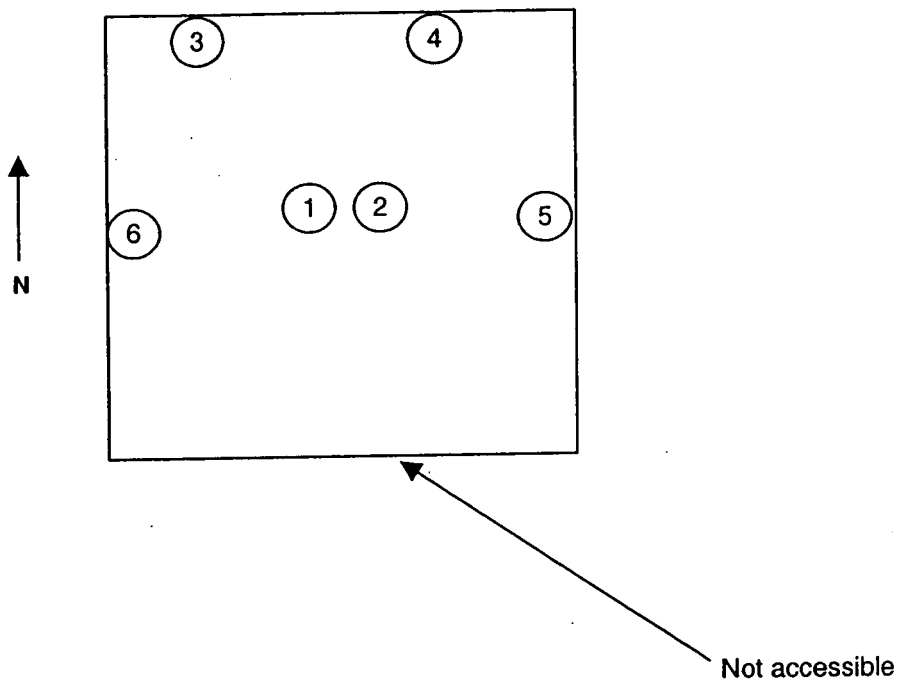

ATTACHMENT D

Chemical Data Summaries and Sample Maps

Beryllium Data Summary


Buildings 995-D1 and 995-D2

Sample Number	RIN	Building	Map Point Location	Room	Sample Location (Biased)	Result (ug/100cm ²)
995-01182005-001	05D0454	995 D-1	1	D-1	West Wall	<0.1
995-01182005-002	05D0454	995 D-1	2	D-1	North Wall	<0.1
995-01182005-003	05D0454	995 D-1	3	D-1	East Wall	<0.1
995-01182005-004	05D0454	995 D-1	4	D-1	South Wall	<0.1
995-01182005-005	05D0454	995 D-1	5	D-1	Inside Upper Pipe @ West Wall	<0.1
995-01182005-006	05D0454	995 D-2	6	D-2	North Wall	<0.1
995-01182005-007	05D0454	995 D-2	7	D-2	East Wall	<0.1
995-01182005-008	05D0454	995 D-2	8	D-2	South Wall	<0.1
995-01182005-009	05D0454	995 D-2	9	D-2	West Wall	<0.1
995-01182005-010	05D0454	995 D-2	10	D-2	Inside Upper Pipe @ West Wall	<0.1

CHEMICAL SAMPLE MAP

Building 995-D1
Beryllium

PAGE 1 OF 1

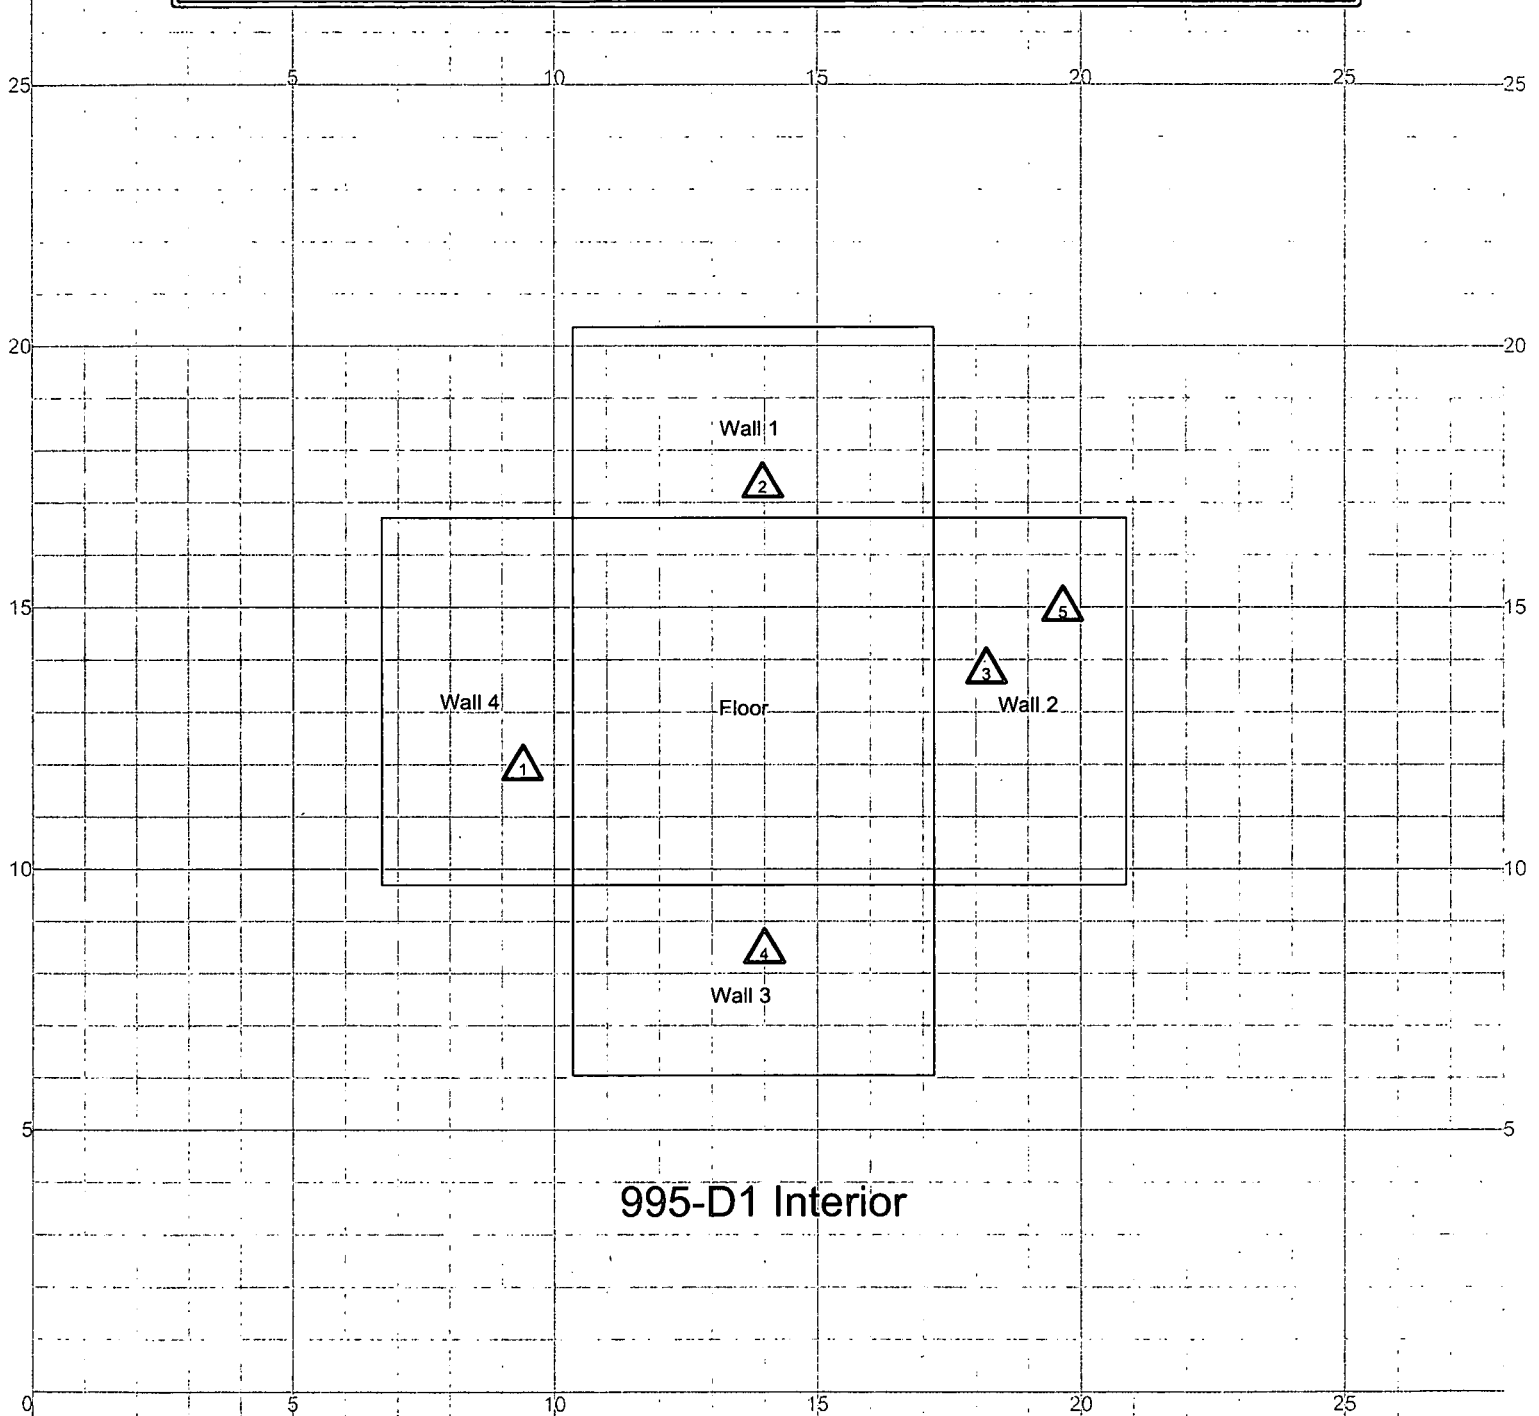


SURVEY MAP LEGEND

- Asbestos Sample Location
- Beryllium Sample Location
- Lead Sample Location
- RCRA/CERCLA Sample Location
- PCB Sample Location

Neither the United States Government, nor Kaiser Hill Co., nor CH2M Hill, nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights.

- Open/Inaccessible Area
- Area in Another Survey Unit



1 inch = 12 feet 1 grid sq. = 1 sq. m.

U.S. Department of Energy
Rocky Flats Environmental Technology Site

Prepared by: GIS Dept. 303-966-7707

Prepared for:



CH2MHILL
Communications Group




MAP ID: 03-0226\995-D1_BE

Jan. 21, 2005

CHEMICAL SAMPLE MAP

Building 995-D2
Beryllium

PAGE 1 OF 1

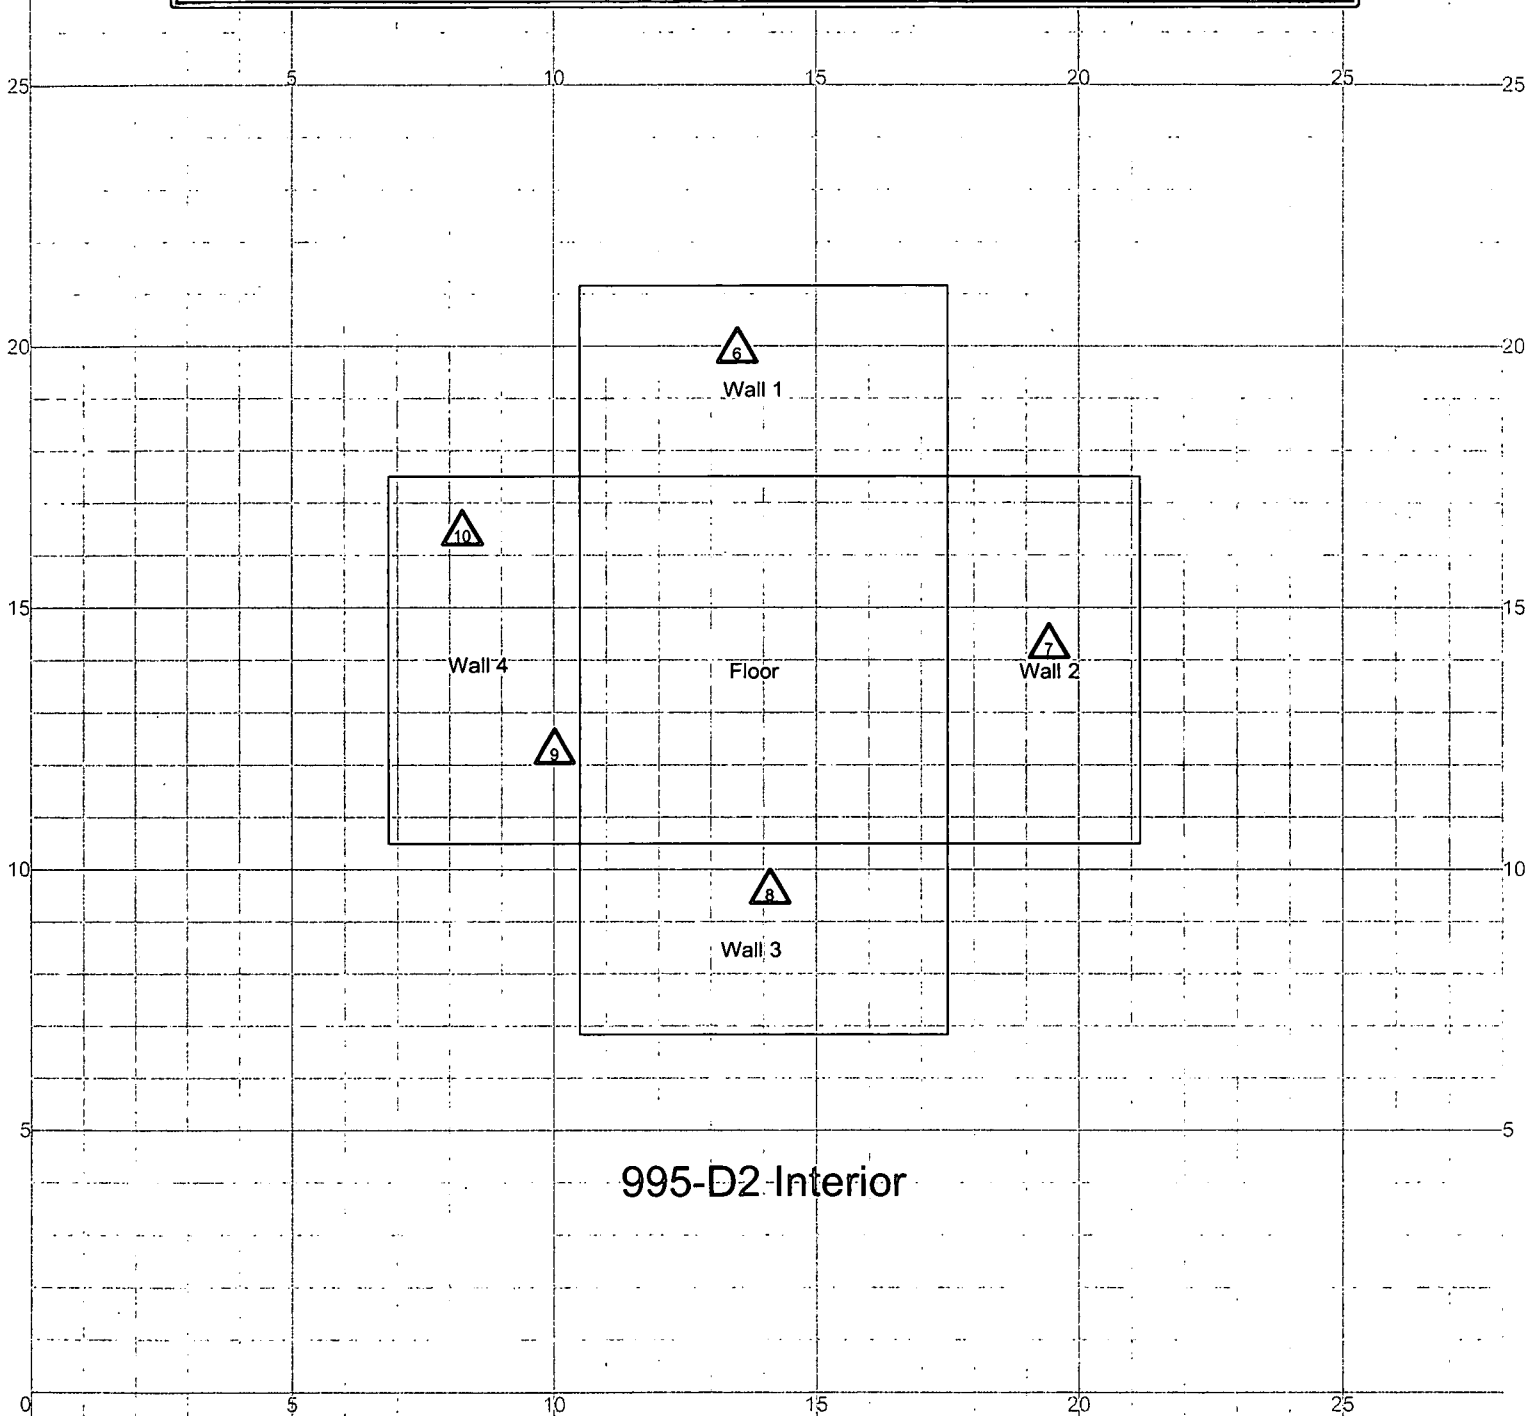


SURVEY MAP LEGEND

- Asbestos Sample Location
- Beryllium Sample Location
- Lead Sample Location
- RCRA/CERCLA Sample Location
- PCB Sample Location

Neither the United States Government, nor Kaiser Hill Co., nor CH2M Hill, nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights.

- Open/Inaccessible Area
- Area in Another Survey Unit



1 inch = 12 feet 1 grid sq. = 1 sq. m.

U.S. Department of Energy
Rocky Flats Environmental Technology Site

Prepared by: GIS Dept. 303-966-7707

Prepared for:



CH2MHILL
Communications Group



MAP ID: 03-0226\995-D2_BE

Jan. 21, 2005

ATTACHMENT E

Data Quality Assessment (DQA) Detail

DATA QUALITY ASSESSMENT (DQA)

VERIFICATION & VALIDATION OF RESULTS

V&V of the data confirm that appropriate quality controls are implemented throughout the sampling and analysis process, and that any substandard controls result in qualification or rejection of the data in question. The required quality controls and their implementation are summarized in a tabular, checklist format for each category of data – radiological surveys and chemical analyses (specifically beryllium).

DQA criteria and results are provided in a tabular format for each suite of surveys or chemical analyses performed; the radiological survey assessment is provided in Table E-1 and beryllium in E-2. A data completeness summary for all results is given in Table E-3.

All relevant Quality records supporting this report are maintained in the RISS Characterization Project Files. This report will be submitted to the CERCLA Administrative Record for permanent storage within 30 days of approval by the Regulators. All radiological data are organized into Survey Packages, which correlate to unique (MARSSIM) Survey Units. Chemical data are organized by RIN (Report Identification Number) and are traceable to the sample number and corresponding sample location.

Beta/gamma survey designs were not implemented for Sewage Treatment Plant Buildings 995-D1 and 995-D2 based on the conservatism of the transuranic limits used as DCGLs in the unrestricted release decision process. Survey designs were implemented based on the transuranic limits used as DCGLs in the unrestricted release decision process. All survey results were evaluated against, and were less than the Transuranic DCGL_w (100 dpm/100cm²) and the Uranium DCGL_w (5,000 dpm/100cm²) unrestricted release limits.

Consistent with EPA's G-4 DQO process, the radiological survey design was optimized by checking actual measurement results (acquired during pre-demolition surveys) against model output with original estimates. Use of actual sample/survey (result) variances in the MARSSIM DQO model confirms that an adequate number of surveys were acquired.

SUMMARY

In summary, the data presented in this report have been verified and validated relative to the quality requirements and project decisions as stated in the original DQOs. All data are useable based on qualifications stated herein and are considered satisfactory without qualification. All media surveyed and sampled yielded results less than their associated action levels and with acceptable uncertainties.

Based upon an independent review of the radiological data, it was determined that the original project DQOs satisfied MARSSIM guidance. All facility contamination levels were below applicable unrestricted release levels. Minimum survey requirements were met, sampling/survey protocol was performed in accordance with applicable procedures, survey units were properly designed and bounded, and instrument performance and calibration were within acceptable limits thereby ensuring data accuracy. All results meet the PDS unrestricted release criteria.

Chain of Custody was intact; documentation was complete, hold times were acceptable (where applicable,) and packaging integrity/custody seals were maintained throughout the sampling/analysis process. Level 2 Isolation Controls have been posted to prevent the inadvertent introduction of contamination into the facilities. On this basis, Sewage Treatment Plant Buildings 995-D1 and 995-D2 meet the unrestricted release criteria with the confidences stated herein.

Table E-1 V&V of Radiological Surveys
Sewage Treatment Plant-Buildings 995-D1 and 995-D2

V&V CRITERIA, RADIOLGICAL SURVEYS		K-H RSP 16.00 Series MARSSIM (NUREG-1575)		
QUALITY REQUIREMENTS				
	Parameters	Measure	Frequency	COMMENTS
ACCURACY	initial calibrations	90%<x<110%	≥1	Multi-point calibration through the measurement range encountered in the field; programmatic records.
	daily source checks	80%<x<120%	≥1/day	Performed daily/within range.
	local area background: Field	typically < 10 dpm	≥1/day	All local area backgrounds were within expected ranges (i.e., no elevated anomalies.)
PRECISION	field duplicate measurements for TSA	≥5% of real survey points	≥10% of reals	N/A
REPRESENTATIVENESS	MARSSIM methodology: Survey Units 995D01 and 995D02 (interior).	statistical and biased	NA	Random w/ statistical confidence.
	Survey Maps	NA	NA	Random and biased measurement locations controlled/mapped to ±1m.
	Controlling Documents (Characterization Pkg; RSPs)	qualitative	NA	Refer to the Characterization Package (planning document) for field/sampling procedures (located in Project files); thorough documentation of the planning, sampling/analysis process, and data reduction into formats.
COMPARABILITY	units of measure	dpm/100cm ²	NA	Use of standardized engineering units in the reporting of measurement results.
COMPLETENESS	Plan vs. Actual surveys usable results vs. unusable	>95% >95%	NA	See Table E-3 for details.
SENSITIVITY	Detection limits	TSA: ≤ 50 dpm/100cm ² RA: ≤ 10 dpm/100cm ²	all measures	MDAs ≤ 50% DCGL _w per MARSSIM guidelines (RLC performed to PDS requirements).

Table E-2 V&V of Beryllium Results
Sewage Treatment Plant-Buildings 995-D1 and 995-D2

V&V CRITERIA, CHEMICAL ANALYSES		DATA PACKAGE	
BERYLLIUM	Prep: NMAM 7300	LAB ---->	Johns Manville Corp. Littleton, Colorado
	METHOD: OSHA ID-125G	RIN ---->	RIN05D0454
QUALITY REQUIREMENTS			
ACCURACY		Measure	Frequency
		Calibrations	≥1
	Initial	linear calibration	≥1
	Continuing	80%<%R<120%	≥1
	LCS/MS	80%<%R<120%	≥1
	Blanks - lab & field	<MDL	≥1
	interference check sid (ICP)	NA	NA
PRECISION	LCS/D	80%<%R<120% (RPD<20%)	≥1
	field duplicate	all results < RL	≥1
	COC	Qualitative	NA
REPRESENTATIVENESS	hold times/preservation	Qualitative	NA
	Controlling Documents (Plans, Procedures, maps, etc.)	Qualitative	NA
	measurement units	ug/100cm ²	NA
COMPARABILITY	Plan vs. Actual samples	>95%	NA
COMPLETENESS	usable results vs. unusable	>95%	NA
SENSITIVITY	detection limits	MDL of 0.00084 ug/100cm ²	all measures
No qualifications significant enough to change project decisions, i.e., classification of Type I facilities confirmed. All results were below associated action levels.			
COMMENTS			

Table E-3 Data Completeness Summary
Sewage Treatment Plant-Buildings 995-D1 and 995-D2

ANALYTE	Building/Area/Unit	Sample Number Planned (Real & QC) ^A	Sample Number Taken (Real & QC)	Project Decisions (Conclusions) & Uncertainty	Comments (RIN, Analytical Method, Qualifications, etc.)
Beryllium	Building 995-D1 (interior)	5 biased (interior)	5 biased (interior)	No beryllium contamination found at any location, all results are below associated action levels	OSHA ID-125G RIN05D0454 No results above action level (0.2ug/100cm ²) or investigative level (0.1 ug/100cm ²).
Beryllium	Building 995-D2 (interior)	5 biased (interior)	5 biased (interior)	No beryllium contamination found at any location, all results are below associated action levels	OSHA ID-125G RIN05D0454 No results above action level (0.2ug/100cm ²) or investigative level (0.1 ug/100cm ²).
Radiological	Survey Area 5 Survey Unit: 995D01 Building 995 Digester D1 (interior)	20 α TSA (15 random/5 biased) and 20 α Smears (15 random/5 biased) 2 QC TSA 20% scan	20 α TSA (15 random/5 biased) and 20 α Smears (15 random/5 biased) 2 QC TSA 20% scan	No elevated contamination at any location; all values below PDS unrestricted release levels	Transuranic DCGLs used.
Radiological	Survey Area 5 Survey Unit: 995D02 Building 995 Digester D2 (interior)	20 α TSA (15 random/5 biased) and 20 α Smears (15 random/5 biased) 2 QC TSA 20% scan	20 α TSA (15 random/5 biased) and 20 α Smears (15 random/5 biased) 2 QC TSA 20% scan	No elevated contamination at any location; all values below PDS unrestricted release levels	Transuranic DCGLs used.